

# Manhole Inspection Summary

Manhole # S39E\_\_019MH

Printed On: 4/10/2009

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39E** Node: **019** Status: **Found**

Insp Date: **1/15/08 2:07 PM**

Incomplete Comments

Crew: **dd**  
Inspector: **jjoiner**  
Firm: **ATS**

**Location** Address: **n.exeter st**

Cross Street: **e.baltimore st**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **The pipes at 3 are sealed up with concrete**

**Cover** Shape: **Circular** Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **1** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **4** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Channel** Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **1** nearest .5 ft. Azimuth: **180**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps** Count: **5** Missing: **1** ☒ **Corroded**

**Surcharge** ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present


# Manhole Inspection Summary

Manhole # S39E\_\_019MH


Printed On: 4/10/2009

Page 2 of 4

Location View

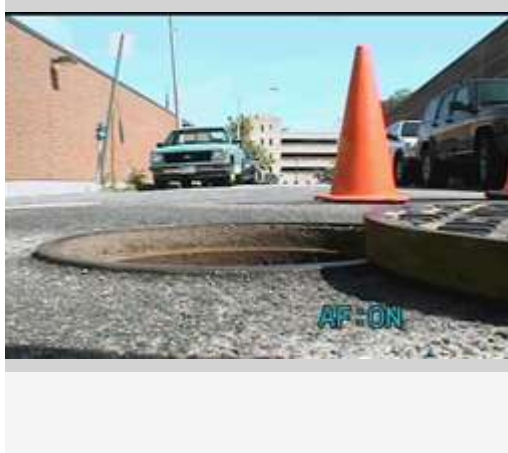

Top View

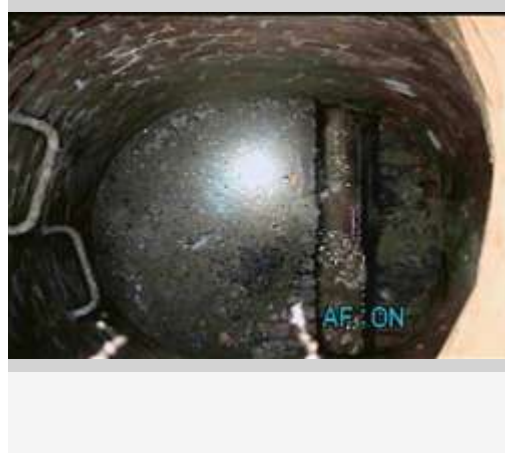

Miscellaneous



cover above pavement

Defect 5



bench debris

Defect 3



channel debris

Defect 2



chimney infiltration from joint; corroded steps

## Defect 1



chimney is deteriorated with loose bricks

## Manhole Inspection Summary

Manhole # S39E\_\_019MH

Printed On: 4/10/2009

Page 4 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 9.90 (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: 9.60 (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: 1 (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection